 
SECRET

CONTROL NO.

Copies

REFERRED TO OFFICE	RECEIVED			RELEASED		14 000228710 SEEN BY		
	SIGNATURE	DATE	TIME	DATE	TIME	NAME & OFFICE SYMBOL	DATE	
DNRO								
							 	
							 	
				l	- 1		i	

Handle Via Indicated Controls



Access to this document will be restricted to those persons cleared for the specific projects;

Note:

In a conversation on the 19th May with I concurred with the judgment of that a response to this letter is neither needed nor desirable and therefore the attached was not sent.

ADW

WARNING

The document contains information affecting the national security of the United States within the meaning of the espionage Livis U. S. Code Title 18, Sections 793 and 794. The law prohibits its transmission or the revelation of its contents in any conner to an incontorized person, as well as its use in any manner precludicial to the safety or interest of the United States of the benefit of any foreign government to the detriment of the United States. It is to be seen only by personnel especially indoctinated and authorized to receive information in the designated control channels. Its security must be maintained in accordance with resultations pertaining to Control System.

Declassified and Released by the NRO

In Accordance with E. O. 12958

on NOV 26 1997 -TOP SECRET

GROLD .

Excluded from automatic downgrading and documentification :

	MENAL					
	SENDER WILL CHEC	K CL	SIFICATION	P	AND BO	ОТТОМ
•	UNCLASSIFIED		CONFIDE	MIYE		SECRET
	CENTRA	L INT	ELLIGENCE A	GENC	Y	
	OFFICI	AL	ROUTING	SL	.IP	
то	/ NAME AND		EŞS	D	ATE	TIALS
1	LX Wise of					
2						
3						
4						
5	O/DD/S&T					
6						
	ACTION	DII	RECT REPLY		PREPARE	REPLY
	APPROVAL	DI	SPATCH		RECOMMI	ENDATION
	COMMENT	FII	LE		RETURN	
	CONCURRENCE	IN	FORMATION		SIGNATU	RE
D						

Remarks:


This is a response to an information report from McMillan regarding the recent CORONA failure. What he fails to mention is that the recovery loss was due to the Air Force AGENA portion of the system and so probably need to put the monkey directly on his back to fix that.

A. D. Wheelon

FOLD HERE	TO RETURN TO SENDER	
FROM: NAME, ADDI	RESS AND PHONE NO.	DATE
O/DD/S&T		17/5/65
UNCLASSIFIED	CONFIDENTIAL	SECRET

FORM NO. 237 Use previous editions

 * U.S. GOVERNMENT PRINTING OFFICE : 1961 0-587282






CENTRAL INTELLIGENCE AGENCY

WASHINGTON, D. C. 20505

 OFFICE OF
THE DEPUTY DIRECTOR (SCIENCE AND TECHNOLOGY)




17 MAY 1985


MEMORANDUM FOR: Director, National Reconnaissance Office

Your memorandum of 13 May 1965 regarding the recent failure of the second recovery event of CORONA 1019 has been referred to this Directorate. We agree with your analysis, and assume that corrective action is being taken through the group responsible for the AGENA portion of the CORONA system.

ALBERT D. WHEELON
Deputy Director

  TO: CESTED







	SENDER WILL C				
-	UNCLASSIFIE		ONFIDENTI		SECRET
	CEN	TRAL INTELLIC	SENCE AGEN	ICY	
		ICIAL RO	UTING S	LIP	
TC	NAME A	ND ADDRESS		DATE	INITIAL
1			43	M 44	N I
			1	11/2	
2				•	
\dashv					
3				110	
			0	119	
4			-5	1	
_			9	48_	
5					
,					-
6					
	ACTION	DIRECT R	EPLY	PREPAR	E REPLY
	APPROVAL	DISPATCH			ENDATION
	SAMMENT.				
	COMMENT	FILE			
len	CONCURRENCE	FILE INFORMAT		RETURN SIGNATU	
Ren	CONCURRENCE		TION	RETURN	
Ren	concurrence narks:	A-	for	info.	
Ren	concurrence narks: Ser	A. TERE TO RETURN DORESS AND PHER	for	info.	IRE

2-61 237

(40) R U.S. GOVERNMENT PRINTING OFFICE: 1961 0-587282 THE SECTION



DEPARTMENT OF THE AIR FORCE WASHINGTON

OFFICE OF THE UNDER SECRETARY

May 13, 1965

MEMORANDUM FOR DIRECTOR, CENTRAL INTELLIGENCE AGENCY DEPUTY SECRETARY OF DEFENSE

On 8 May, after nine successful days on orbit and one successful recovery, the second bucket of CORONA Mission J-1019 failed to reenter the atmosphere following initiation of the recovery cycle. Instead, the bucket went into a new elongated orbit. A brief summary of our assessment of the failure, and of actions taken, follows.

The most probable cause of failure to recover is that the vehicle had executed a second and additive pitch maneuver prior to separation of the capsule. Thus, the vehicle was then pointing down and forward so that the retro-rocket added net energy to the capsule rather than subtracting it. This placed the capsule in a new orbit with a perigee of 80 nm, apogee of 620 nm, and a period of 98 minutes (as compared to 100 nm, 260 nm, and 91 minutes at the time recovery was attempted).

The second pitch maneuver probably was caused by a redundant (back-up) pitch command on the H-Timer tape. Normally, this command does not take effect when the first pitch command is properly executed; analysis now shows, however, that there is a subtle failure mode in which an auxiliary circuit can direct a second maneuver prior to capsule separation.

We estimate the capsule will remain in the new orbit for 40-60 days. SPADATS now reports four objects in this orbit. Since the normal sequence of events took place after retrorocket fire, it is most likely that these objects are the heat shield, capsule, thrust cone, and parachute cover. A special watch has been established with SPADATS for the reporting of the predicted impact points.



Since the heat shield appears to have separated from the capsule, it seems unlikely that any of the exposed film will survive reentry into the atmosphere. Nevertheless, film is an excellent ablative material itself and the possibility does exist for survival of some inner portion. We therefore will follow orbit decay and reentry quite closely.

A simple and complete fix will be incorporated in all subsequent CORONA vehicles to preclude any possibility of recurrence.

Brockway McMillan

Director

National Reconnaissance Office



2