

A. 1843-2

B. REF

THE H-TIMER TAPE WAS SLIPPED MINUS 110 SEC
TO COMPLY WITH THE REF REQUEST FOR 6 DEG 25 MIN NORTH BIAS. SLIPPING
THE TAPE IN A MINUS DIRECTION CAUSES A LOSS OF STORED PROGRAM
COMMAND FUNCTIONS FOR THE PERIOD OF TIME OF THE SLIPPAGE, IN THIS
CASE, 110 SECONDS. ON REV 120 ONE OF THE SPC FUNCTIONS THAT WAS
LOST WAS THE V/H PROGRAMMER START STEP. THIS CAUSED THE V/H PROGRAMMER
TO REMAIN AT THE BOTTOM OF THE RAMP, THE SLOWEST CYCLE RATE,
THROUGHOUT THE REV RESULTING IN IMPROPER MATCH DURING THE OPS
TAKEN ON REV 120.

IF THE TAPE IS SLIPPED IN A PLUS DIRECTION, SPC FUNCTIONS WOULD BE REPEATED FOR THE PERIOD OF TIME OF THE SLIPPAGE.

IN THE FUTURE WILL BE ADVISED OF ADVERSE AFFECTS ON

TOPCECREI

ANOUN I SECURISHING WASON THOUSAND PROMISE ANNUAL PROPERTY OF THE PROPERTY OF

SPC FUNCTIONS RESULTING FROM BLASING THE H-TIMER AND RESIDERT OFFICER WILL RECOMMEND AGAINST A BIAS THAT HOULD COMPROMISE MISSION QUALITY.

TOPSECRET TOR: 151933Z AUG 67